



DANGER


Danger of electrical shock, burns or death. Always remove all power sources before attempting any repair, service or diagnostic work. Power can be present from shore power, generator, inverter or battery. All power sources must be disabled and secured before performing any service.



CAUTION

If you lack the skills, tools or equipment to perform diagnostic or repair work leave such work to an authorized Winnebago Industries dealer or other qualified shop.

CONTROL CENTER BREAKER PANEL

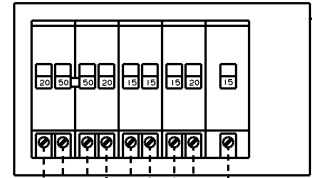

GROUND BAR

RECP-LEFT BEDROOM OR RECP-NIGHTSTAND

RECP-RIGHT BEDROOM

RECP MICROWAVE
RECP GFI GALLEY

4 X 4 BOX (LOCATED IN LAVATORY CABT)
4 X 4 BOX (LOCATED IN GALLEY CABT)

RECP-BLANK OVHD DINETTE (LOCATED IN DINETTE OVHD)

RECP LOUNGE RH

RECP TV FRONT

RECP COFFEE MAKER

RECP EXT ENT CTR

RECP DINETTE

RECP REFRIGERATOR

RECP CONVERTER

RECP GFI BATH

RECP-BLANK REFRIGERATOR (LOCATED BEHIND CONVERTER)

RECP EXTERIOR

RECP TV BEDROOM

RECP-BLANK TV, BEDROOM, RH (LOCATED IN LINEN CABT)

RECP-BLANK A/C REAR (LOCATED IN LINEN CABT)

RECP-BLANK A/C FRONT (LOCATED IN LINEN CABT)

FRONT AIR CONDITIONER

REAR AIR CONDITIONER

AUTOMATIC TRANSFER SWITCH

4 X 4 JCT BOX IN GENERATOR COMPARTMENT

GENERATOR

GROUND BAR

POWER CORD RECP

- (10) TWIN BEDS.
- (9) USED WITH REAR QUEEN.
- (8) USED WITH COFFEE MAKER.
- (7) USED WITH EXTERIOR ENTERTAINMENT CENTER
- (6) WIRE ROUTED BELOW MAIN FLOOR.
- (5) NOT USED WITH COFFEE MAKER.
- (4) WIRE ROUTED IN ROOF.
- (3) WIRE ROUTED IN SIDEWALL.
- (2) PROTECTED BY GROUND FAULT INTERRUPTER RECP.
- (1) SEE MANUFACTURER'S WIRING DIAGRAM FOR ADDITIONAL INFORMATION

98 G33WQ
78J ELECTRICAL SYS-50 AMP
IBI CODES/STANDARDS USA

TITLE		WIRING DIAGRAM-BODY 110V	
NO. OF SHEETS	DATE	REV.	DATE
2 OF 3	1.6		
SHEET		128281	

CONTROL CENTER
BREAKER PANEL



GROUND BAR

RECP-LEFT
BEDROOM
OR
RECP-NIGHTSTAND

RECP-RIGHT
BEDROOM

RECP-APPL
GALLEY GFI

RECP-MICROWAVE

RECP-APPL
DINETTE

RECP TV
BEDROOM

RECP-BLANK
OVHD DINETTE
(LOCATED IN
DINETTE OVHD)

RECP LOUNGE RH

RECP TV FRONT

RECP COFFEE
MAKER

RECP-BLANK
TV, BEDROOM RH
(LOCATED IN
LINEN CABT)

RECP EXT ENT
CTR

RECP REFRIGERATOR

RECP CONVERTER

RECP-BLANK
REFRIGERATOR
(LOCATED BEHIND
CONVERTER)

RECP GFI BATH

RECP-BLANK
A/C FRONT
(LOCATED IN
LINEN CABT)

RECP-BLANK
A/C REAR
(LOCATED IN
LINEN CABT)

FRONT AIR
CONDITIONER

REAR AIR
CONDITIONER

AUTOMATIC
TRANSFER
SWITCH

4 X 4 JCT BOX
IN GENERATOR
COMPARTMENT

GENERATOR

GROUND BAR

GROUND

- (10) TWIN BED.
- (9) NOT USED WITH COFFEEMAKER.
- (8) USED WITH COFFEEMAKER.
- (7) USED WITH EXTERIOR ENTERTAINMENT CENTER
- (6) WIRE ROUTED BELOW MAIN FLOOR.
- (5) USED WITH REAR QUEEN.
- (4) WIRE ROUTED IN ROOF.
- (3) WIRE ROUTED IN SIDEWALL.
- (2) PROTECTED BY GROUND FAULT INTERRUPTER RECP.
- (1) SEE MANUFACTURER'S WIRING DIAGRAM FOR ADDITIONAL INFORMATION

98 G33WQ
78J ELECTRICAL SYS-50 AMP
265 CODES/STDS/CSA/CMVSS

TITLE		WIRING DIAGRAM-BODY	
NO. OF SHEETS	3	SHEET NO.	3
DATE		128281	